



Mussafah Industrial Area M14, plot 75, Abu Dhabi

Hotline: 800 79477 | Website: www.swissauto.ae

AuhJCTN0027055

Plate No: 90175

Vehicle Make: BMW

Vehicle Model: ALPINA B3

Engine Type: 6 Cylinder

Customer Name : MANSOUR MAHCYP FIATIAKHOTDINOV

Date: 21.10.2024

Technical Remarks	Action Required
intercooler to turbo hose leak	need to replace performance hose o ring
air filter dusty	need to replace
ac filter dusty	need to replace
coolant tank cap damage	need to replace
engine oil service 15000 km showing on cluster	no service sticker found on vehicle
engine oil service 15000 km showing on cluster	recommended to replace engine oil and filter
brake fluid bad condition	need to replace with brake bleeding
found fuel leak mark from fuel tank	need to replace fuel tank with fuel pump o ring
front front both shock mounting damage and shock buffer bush crack	need to replace front both shock mounting with buffer bush and repair kit
	while removing need to check both shock condition / if damage need to replace
rear both side shock buffer bush damage	need to replace buffer bush with repair kit
	while removing need to check both shock condition
carried out endoscopy and compression test / found all ok	



Mussafah Industrial Area M14, plot 75, Abu Dhabi

Hotline: 800 79477 | Website: www.swissauto.ae

recovered 831 g ac gas and refilled 590 g ac gas	compressor performance ok and ac cooling good
checked and not found coolant leak / oil leak	
brakes remaining 50 %	
tyre and battery good	

Prepared by Service Advisor,

Abdelrahman Shaker