



**PRE-PURCHASE
YELLOW BOOK**

BESOJI FZ-LLC

IN5 TECH, MEDIA CITY

+971 56 817 8171

HELLO@BESOJI.COM



Type Of Inspection

Comprehensive Inspection

Date

Thursday, November 28, 2024

Vehicle Details

Make	Model	Year
MERCEDES-BENZ	CL600	2003
Engine Size	Mileage (KM)	Fuel Type
12-Cylinder	101516	Petrol
Regional Specs	Transmission	Interior
Japanese	Automatic	Leather
VIN Number	Number of Keys	Spare Tire
WDB2153761A031818	1	Available

Service History

Not Available

User Manual

Not Available

Vehicle Summary

We've explained **some** of the faults below.
Please refer to the full report for all the faults.

Valve Cover Gasket Leak

The valve cover gasket is a seal that is placed between the valve cover and the cylinder head of an engine. Its main purpose is to prevent oil leaks from the valve cover. Despite being a common type of oil leak, replacing the gasket ensures optimal engine life, Long-term oil leaks can be dangerous for the engine life span. Labor cost: High

Inspector Comments

Engine Oil leak from multiple places.
Rubber coupling for the drive shaft is cracked.
Suspension bushes cracked.
Hydraulic pipe for the right shock is leaking.
Rear both axle boot cracked.
Front left fender is broken.
Right Side mirror adjustment not working.
Blower motor button not working properly.
Right door not opening properly.
Engine valve cover broken.
Numerous fault codes present in post test drive diagnosis.

Repair cost ranges are general and not final. We offer these estimates to provide you more clarity on deciding if you should buy the car or not. These estimates may vary depending on the vehicle make and model, current labor rates, time period issue is present and the complexity of the repair.

Engine Upper Cover

Pass

Engine Shield Cover

Pass

Engine Mounts

Pass

Engine Oil Condition

Pass

Engine Oil Leaks

Leak from valve cover/camshaft gasket

Engine leaking from rear main seal.

Engine Oil Filler Cap

Pass

Engine Oil Leak Fault - Photo



IMG_20241128_2025...



IMG_20241128_1958...

Coolant Level

Pass

Coolant Cap

Pass

Turbo / Supercharger

N/A

Visible Rust

Pass

Exhaust System

Pass

Engine Idle

Pass

Bonnet Hinge & Holder

Pass

Fender Liners

Pass

Drive Belt / Pulleys

Pass

Hoses & Pipes

Pass

Radiator

Pass

Battery Condition ⚡ ⚡ ⚡ ⚡ ⚡

Fluid Level & Condition

No Dipstick Available To Check

Transmission Fluid Leaks

Pass

Gear Selector

Pass

Gear Shifting

Pass

Noise

Pass

Please review the car diagnostic report at the end of this document for more information on the transmission condition.

Key Remote

Pass

Entertainment System

Pass

Center Console Buttons

Ac blower motor button not working.

Center Console Buttons Fault



IMG_20241128_2045...

Door Lock / Unlock

Pass

Cameras

Not working

Cruise Control

Pass

Cameras Fault



IMG_20241128_2028...

A/C Control & Cooling

Pass

Starting & Ignition System

Pass

Gauges

Pass

Fog Lights

Pass

Headlights

Pass

Brake Lights

Pass

A/C Grilles

Pass

High Beams

Pass

Reverse Lights

Pass

Number Plate Lights

1 light not working

Indicators & Hazards

Pass

Soft Closing Doors

Pass

Number Plate Lights Fault



IMG_20241128_2053...

Wipers

Pass

Interior Lights

Pass

Sunroof / Moonroof

Pass

Windows Operation

Pass

Seats Adjustment

Pass

Rear View / Side Mirrors

Both side mirror rubber beading damaged. Rightside mirror adjustment not working.

Rear View/ Side Mirror Fault



IMG_20241128_1939...



IMG_20241128_1940...

Horn

Pass

Parking Sensors Fault

Pass

Brake Pads Front

Pass

Brake Discs Front

Need to skim

ABS Sensors

Pass

Front Suspension

Both side upper arm bush cracked. Both side lower arm bush broken. right side shock hydronic line leaking.both control arm bush broken.

Front Suspension Fault - Photo



[IMG_20241128_195718.jpg](#)



[IMG_20241128_195729.jpg](#)

Brake Pads Rear

Pass

Brake Discs Rear

Need to skim

Handbrake

Pass

Rear Suspension

Rear both axle boot cracked. Driveshaft mount broken.

Rear Suspension Fault - Photo



[290_IMG_20241128_203620_1460.jpg](#)



[290_IMG_20241128_203229_7006.jpg](#)



IMG_20241128_200209.jpg



IMG_20241128_200159.jpg



IMG_20241128_200251.jpg



IMG_20241128_203232.jpg



IMG_20241128_203240.jpg



[IMG_20241128_200359.jpg](#)



[IMG_20241128_201536.jpg](#)

Rims

	Brand	Condition
Front Left	Original	Minor chipping
Front Right	Original	Minor Chipping
Rear Left	Original	Minor chipping
Rear Right	Original	Minor chipping

Tyres

	Manufacturer	Date	Size	Condition
Front Left	Headking habilead	2023	245/45zr18	5/7mm good
Front Right	Headking habilead	2023	245/45zr18	5/7mm good
Rear Left	Headking habilead	2023	245/45zr18	5/7mm good
Rear Right	Headking habilead	2023	275/40zr18	5/7mm good

Roof Lining

Pass

Rear View Mirror

Pass

Armrest & Side Pockets

Pass

Steering Wheel Upholstery

Pass

Seats Upholstery

Pass

Gear Lever

Pass

Floor Mats

Pass

Trunk Lining

Pass

Dashboard

Dashboard center trim panel cracked

Dashboard Fault



IMG_20241128_1937...

Front Windscreen

Pass

Rear Windscreen

Pass

Doors

Driver door interior trim cloth loose. Passenger door not opening properly.

Doors Fault




IMG_20241128_1940...



IMG_20241128_1934...

Paint Condition Report

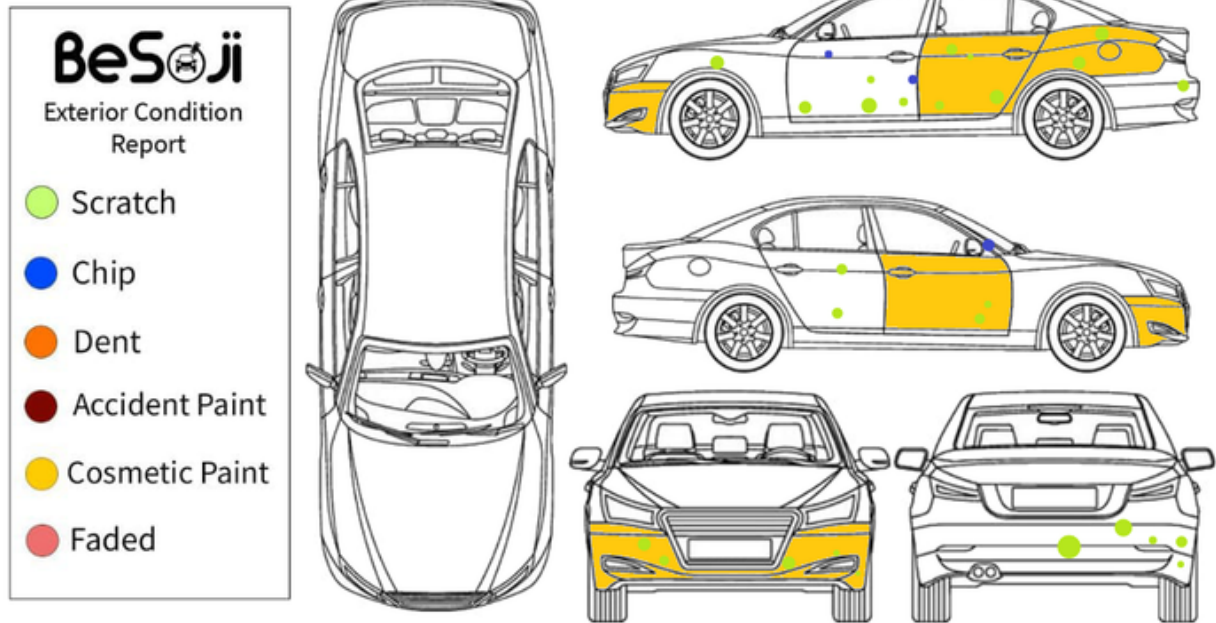


Key Details

- **Scratch:** A minor or major scratch
- **Paint Chip:** A small to medium part of the paint has been removed
- **Dent:** A minor or major depression or hollow on the vehicle body
- **Accident Paint:** Filler used to smoothen out the panel due to a deep crack or damage, followed by repainting of the panel.
- **Cosmetic Paint:** No filler used, usually a repaint due to minor imperfections on the paint. e.g. stone chips, door dings, etc.
- **Faded:** Paint and/or lacquer has been worn out due to extreme weather. Appears as a dull, washed out appearance and, at times discoloration.



Chassis, Subframe & Internal Damage Report

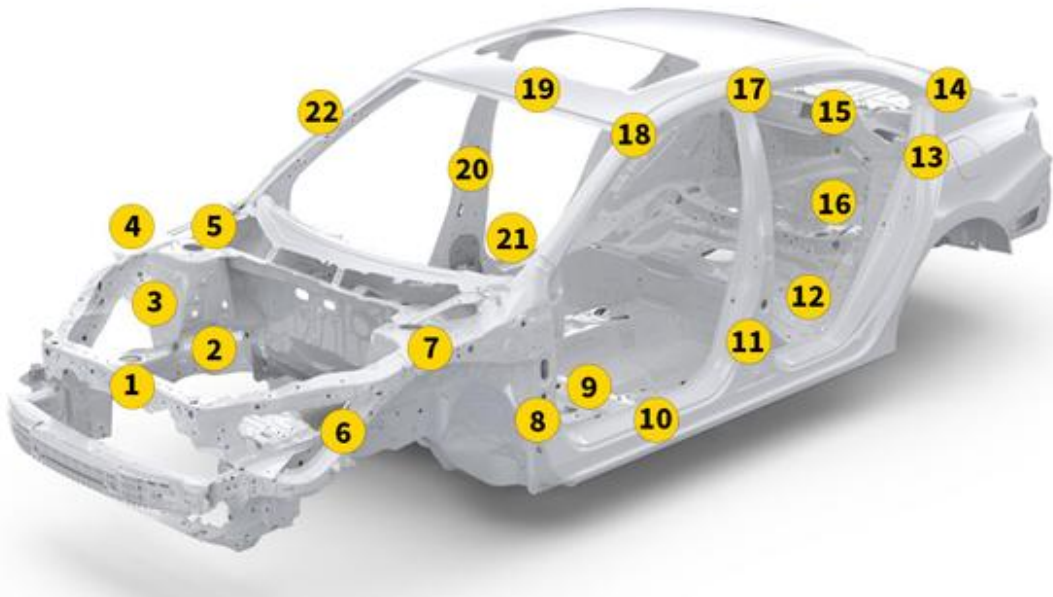

Damage on Chassis / Subframe:

PASS

General Exterior Photos



IMG_20241128_1905...
1.72 MB



IMG_20241128_1905...
1.71 MB



IMG_20241128_1905...
1.82 MB



IMG_20241128_1905...
2.16 MB



IMG_20241128_1905...
1.7 MB



IMG_20241128_1905...
1.73 MB



IMG_20241128_1906...
1.86 MB



IMG_20241128_1906...
1.65 MB



IMG_20241128_1906...
2.04 MB



IMG_20241128_1906...
1.92 MB



IMG_20241128_1906...
2.01 MB



IMG_20241128_1906...
1.79 MB



IMG_20241128_1906...
1.76 MB



IMG_20241128_1906...
1.74 MB



IMG_20241128_1906...
1.9 MB



IMG_20241128_1906...
1.66 MB

Engine Bay & Undercarriage



IMG_20241128_2036...
1.51 MB



IMG_20241128_2035...
1.48 MB



IMG_20241128_2036...
1.45 MB



IMG_20241128_2035...
1.52 MB



IMG_20241128_2034...
1.6 MB



IMG_20241128_2035...
1.8 MB



IMG_20241128_2034...
1.8 MB



IMG_20241128_2034...
2.02 MB



IMG_20241128_2034...
1.68 MB



IMG_20241128_2033...
1.25 MB



IMG_20241128_2033...
1.35 MB



IMG_20241128_2033...
1.47 MB



IMG_20241128_2032...
1.33 MB



IMG_20241128_2032...
1.43 MB



IMG_20241128_1950...
1.89 MB



IMG_20241128_1948...
1.64 MB



IMG_20241128_1956...
1.4 MB



IMG_20241128_1948...
1.83 MB



IMG_20241128_1951...
2.16 MB



IMG_20241128_1956...
1.42 MB



IMG_20241128_1956...
1.72 MB

Interior Photos



IMG_20241128_1929...
1.71 MB



IMG_20241128_1929...
1.84 MB



IMG_20241128_1930...
2.06 MB



IMG_20241128_1930...
1.96 MB



IMG_20241128_1930...
1.97 MB



IMG_20241128_1930...
1.83 MB



IMG_20241128_1930...
1.49 MB




IMG_20241128_1930...
1.42 MB



IMG_20241128_1930...
1.85 MB



IMG_20241128_1931...
1.48 MB

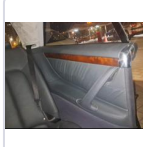

IMG_20241128_1931...
1.72 MB



IMG_20241128_1931...
1.86 MB



IMG_20241128_1931...
1.98 MB



IMG_20241128_1932...
1.78 MB



IMG_20241128_1932...
1.71 MB



IMG_20241128_1932...
1.54 MB



IMG_20241128_1932...
2.07 MB



IMG_20241128_1933...
1.25 MB



IMG_20241128_1933...
1.75 MB

Vehicle Diagnostic Report



Mercedes-Benz_WDB2153761A031818_AllSystemDTC_20241128090013.pdf



Mercedes-Benz_WDB2153761A031818_AllSystemDTC_20241128071149.pdf



Powered by **Shory**.

WE JUST OUTPERFORMED YOUR INSURANCE BROKER

We've built the insurance experience from the ground up!

- Get Car Insurance Without Talking To A Human - For The First Time Ever!
- Lowest quotes, transparent pricing, instant cover available 24/7. Policy issued to RTA in 3 minutes.

TRY THE MAGIC



Terms of Service

All services from BeSoji are provided on an "as is, with all defects" and "as available" basis without warranties of any kind, either expressed or implied, including without limitation, warranties of title, non-infringement, or implied warranties of merchantability or fitness for a particular purpose. Nothing in these terms or in any description of products or services in the services shall constitute a representation or warranty with respect to such products or services.

The inspection of the vehicle described in this report is external and we are unable to accept responsibility for failure to identify defects not present or apparent at the time of the inspection. Odometer readings may have been tampered with, although we report any signs that we notice of this happening during inspection. You acknowledge, by your use of the services, that such use is at your sole risk. In the event of dissatisfaction or a complaint, we reserve the right to re-examine the vehicle prior to any rectifications to the vehicle. You agree that BeSoji's liability is limited to refunding the price you pay for the inspection in the event you are dissatisfied with BeSoji's service, or injuries occur due to an unreported defect in the vehicle. All requests should be sent to hello@besoji.com within 7 days notice of receiving the report.

in no event shall either BeSoji or its affiliates or agents be liable for any direct, indirect, punitive, incidental, special or consequential damages arising out of or in any way connected with the use of the services, whether based on contract, tort, strict liability or otherwise, even if advised of the possibility of any such damages.