



www.BeSoji.com



PRE-PURCHASE YELLOW BOOK

BESOJI FZ-LLC

+971 56 817 8171

IN5 TECH, MEDIA CITY

HELLO@BESOJI.COM



Type Of Inspection

Comprehensive Inspection

Date

Wednesday, July 31, 2024

Time

11:00 AM

Vehicle Details

Make

BMW

Model

E46 M3

Year

2001

Engine Size

6-Cylinder

Mileage (KM)

171591

Fuel Type

Petrol

Regional Specs

European

Transmission

Manual

Interior

Leather

VIN Number

WBAAW31070JV36258

Number of Keys

3

Spare Tire

Available

Vehicle Summary

We've explained **some** of the faults below.
Please refer to the full report for all the faults.

Drain Plug Leak

- A leak from the oil drain plug indicates that the plug, which is used to drain the engine oil during an oil change, may not be tightened properly or the gasket/seal around the plug is damaged. It's crucial to address this promptly to prevent oil loss and potential engine damage. Labor cost: Low To Medium

Inspector Comments

S54 M3 Engine Swap, E46 M3 5-Speed Manual Swap
Front & rear sub frames reworked,
Completely replaced all the parts from another one, and repainted
Vibration available
Engine noise available
Humming noise available

Repair cost ranges are general and not final. We offer these estimates to provide you more clarity on deciding if you should buy the car or not. These estimates may vary depending on the vehicle make and model, current labor rates, time period issue is present and the complexity of the repair.

Engine Upper Cover

Pass

Engine Shield Cover

Pass

Engine Mounts

Pass

Engine Oil Condition

Pass

Engine Oil Leaks

Leak from oil drain plug

Engine Oil Filler Cap

Pass

Engine Oil Leak Fault - Photo



IMG_20240731_1208...

Coolant Level

Pass

Coolant Cap

Pass

Turbo / Supercharger

Pass

Visible Rust

Minor rust

Exhaust System

Pass

Engine Idle

Pass

Visible Rust Fault - Photo



IMG_20240731_1208...



IMG_20240731_1208...

Bonnet Hinge & Holder

Pass

Fender Liners

Pass

Drive Belt / Pulleys

Squeaking belt sounds

Hoses & Pipes

Pass

Radiator

Pass

Drive Belt / Pulleys Fault - Photo



IMG_20240731_1227...

Battery Condition ⚡ ⚡ ⚡ ⚡ ⚡

Fluid Level & Condition

No Dipstick Available To Check

Transmission Fluid Leaks

Minor leak on drain plug

Transmission Fluid Fault - Photo



IMG_20240731_1208...



287_IMG_20240731_...

Gear Selector

Pass

Gear Shifting

Pass

Noise

Noise detected

Please review the car diagnostic report at the end of this document for more information on the transmission condition.

Key Remote

Pass

Entertainment System

Pass

Center Console Buttons

Pass

Door Lock / Unlock

Pass

Cameras

Pass

Cruise Control

Pass

A/C Control & Cooling

Pass

Starting & Ignition System

Pass

Gauges

Pass

Fog Lights

Pass

Headlights

Pass

Brake Lights

Pass

A/C Grilles

Pass

High Beams

Pass

Reverse Lights

Pass

Number Plate Lights

Pass

Indicators & Hazards

Pass

Soft Closing Doors

N/A

Wipers

Pass

Interior Lights

Pass

Sunroof / Moonroof

Pass

Windows Operation

Pass

Seats Adjustment

Pass

Rear View / Side Mirrors

Pass

Horn

Pass

Parking Sensors Fault

Pass

Brake Pads Front

Pass

Brake Pads Rear

Pass

Brake Discs Front

Pass

Brake Discs Rear

Pass

ABS Sensors

Pass

Handbrake

Pass

Front Suspension

Pass

Rear Suspension

Pass

Rims

	Brand	Condition
Front Left	Original	Good
Front Right	Original	Good
Rear Left	Original	Scratches
Rear Right	Original	Scratches

Tyres

	Manufacturer	Date	Size	Condition
Front Left	Kumho	2023	215/40ZR18	5/7 mm
Front Right	Kumho	2023	215/40ZR18	5/7 mm
Rear Left	Nexen	2023	255/35ZR18	5/7 mm
Rear Right	Nexen	2023	255/35ZR18	5/7 mm

Roof Lining

Minor scratches

Rear View Mirror

Pass

Armrest & Side Pockets

Damage

Roof Lining Fault



246_IMG_20240731_...



246_IMG_20240731_...



IMG_20240731_1146...

Armrest & Side Pockets Fault



252_IMG_20240731_...

Steering Wheel Upholstery

Minor scratches

Seats Upholstery

Wear and tear

Gear Lever

Minor scratches

Steering Wheel Upholstery Fault




248_IMG_20240731_...

Seats Upholstery Fault



249_IMG_20240731_...



249_IMG_20240731_...

Gear Lever Fault



250_IMG_20240731_...

Floor Mats

Pass

Trunk Lining

Pass

Dashboard

Pass

Front Windscreen

Pass

Rear Windscreen

Pass

Doors

Pass

Service History & Manuals




Service History

Available (ask seller to change ownership with agency for proof)

User Manual

Available

Paint Condition Report

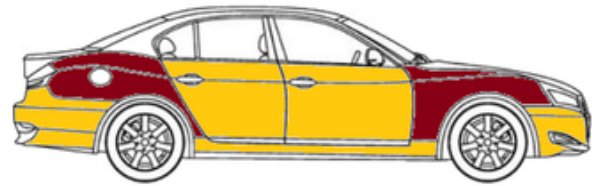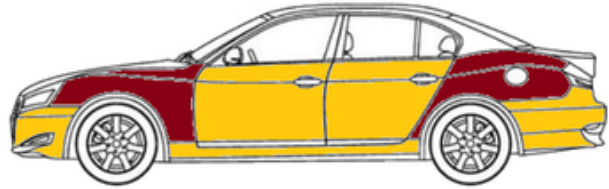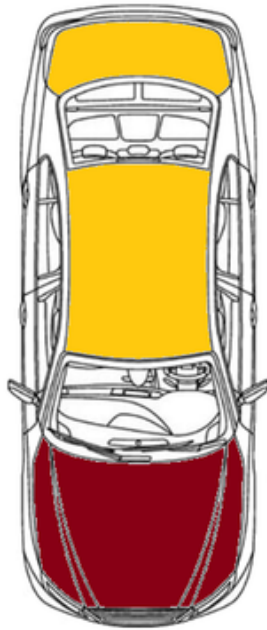


Key Details

- **Scratch:** A minor or major scratch
- **Paint Chip:** A small to medium part of the paint has been removed
- **Dent:** A minor or major depression or hollow on the vehicle body
- **Accident Paint:** Filler used to smoothen out the panel due to a deep crack or damage, followed by repainting of the panel.
- **Cosmetic Paint:** No filler used, usually a repaint due to minor imperfections on the paint. e.g. stone chips, door dings, etc.
- **Faded:** Paint and/or lacquer has been worn out due to extreme weather. Appears as a dull, washed out appearance and, at times discoloration.



Chassis, Subframe & Internal Damage Report

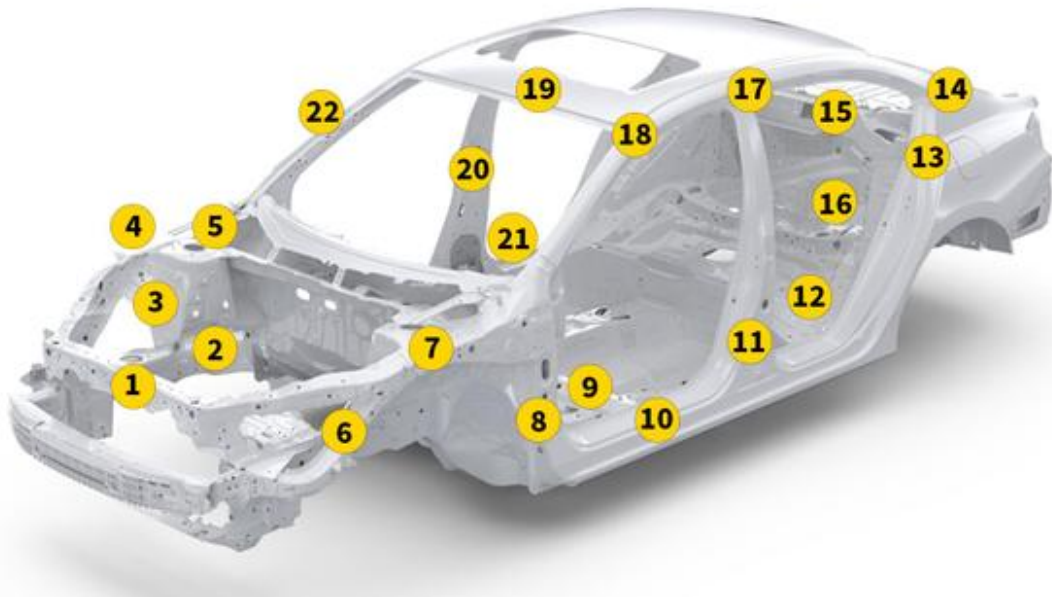

Damage on Chassis / Subframe:

PASS

General Exterior Photos



IMG_20240731_1124...
510.21 KB



IMG_20240731_1124...
491.16 KB



IMG_20240731_1131...
543.52 KB



IMG_20240731_1138...
527.96 KB



IMG_20240731_1138...
543.17 KB



IMG_20240731_1138...
537.8 KB



IMG_20240731_1138...
566.94 KB



IMG_20240731_1138...
549.51 KB



IMG_20240731_1138...
565.68 KB



IMG_20240731_1138...
538.52 KB



IMG_20240731_1138...
552.33 KB



IMG_20240731_1141...
578.83 KB



IMG_20240731_1141...
593.26 KB



IMG_20240731_1141...
561.22 KB



IMG_20240731_1141...
556.18 KB



IMG_20240731_1141...
534.26 KB



IMG_20240731_1142...
550.01 KB



IMG_20240731_1142...
545.81 KB



IMG_20240731_1142...
536.5 KB



IMG_20240731_1214...
510.84 KB



IMG_20240731_1215...
517.94 KB



IMG_20240731_1215...
493.89 KB



IMG_20240731_1215...
502.36 KB



IMG_20240731_1215...
480.12 KB

Interior Photos



IMG_20240731_1136...
599.68 KB



IMG_20240731_1142...
549.61 KB



IMG_20240731_1142...
567.72 KB



IMG_20240731_1142...
572.98 KB



IMG_20240731_1142...
615.91 KB



IMG_20240731_1142...
606.48 KB



IMG_20240731_1143...
561.01 KB



IMG_20240731_1143...
556.85 KB



IMG_20240731_1143...
545.96 KB



IMG_20240731_1143...
607.52 KB



IMG_20240731_1143...
556.34 KB



IMG_20240731_1143...
590.33 KB



IMG_20240731_1143...
590.87 KB



IMG_20240731_1143...
634.45 KB



IMG_20240731_1144...
582.31 KB



IMG_20240731_1144...
568.44 KB




IMG_20240731_1144...
673.78 KB




IMG_20240731_1144...
538.39 KB



IMG_20240731_1144...
525.6 KB

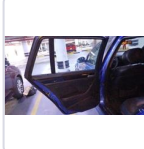

IMG_20240731_1145...
546.81 KB

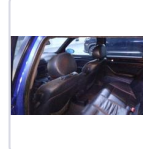

IMG_20240731_1145...
547.56 KB



IMG_20240731_1145...
565.42 KB



IMG_20240731_1145...
566.29 KB



IMG_20240731_1145...
563.8 KB



IMG_20240731_1146...
551.58 KB



IMG_20240731_1146...
526.27 KB



IMG_20240731_1146...
636.52 KB



IMG_20240731_1146...
555 KB



IMG_20240731_1147...
535.65 KB



IMG_20240731_1147...
578.72 KB



IMG_20240731_1147...
578.33 KB

Vehicle Diagnostic Report



BMW(DTC)_989350001593_20240731122459.pdf



WE JUST OUTPERFORMED YOUR INSURANCE BROKER

We've built the insurance experience from the ground up!

- Get Car Insurance Without Talking To A Human - For The First Time Ever!
- Lowest quotes, transparent pricing, instant cover available 24/7. Policy issued to RTA in 3 minutes.

TRY THE MAGIC



Terms of Service

All services from BeSoji are provided on an "as is, with all defects" and "as available" basis without warranties of any kind, either expressed or implied, including without limitation, warranties of title, non-infringement, or implied warranties of merchantability or fitness for a particular purpose. Nothing in these terms or in any description of products or services in the services shall constitute a representation or warranty with respect to such products or services.

The inspection of the vehicle described in this report is external and we are unable to accept responsibility for failure to identify defects not present or apparent at the time of the inspection. Odometer readings may have been tampered with, although we report any signs that we notice of this happening during inspection. You acknowledge, by your use of the services, that such use is at your sole risk. In the event of dissatisfaction or a complaint, we reserve the right to re-examine the vehicle prior to any rectifications to the vehicle. You agree that BeSoji's liability is limited to refunding the price you pay for the inspection in the event you are dissatisfied with BeSoji's service, or injuries occur due to an unreported defect in the vehicle. All requests should be sent to hello@besoji.com within 7 days notice of receiving the report.

in no event shall either BeSoji or its affiliates or agents be liable for any direct, indirect, punitive, incidental, special or consequential damages arising out of or in any way connected with the use of the services, whether based on contract, tort, strict liability or otherwise, even if advised of the possibility of any such damages.